

PT303 Strain Gage Pressure Transmitter

Explosion proof pressure transmitter with integrated amplifier for use in hazardous environments



 






OPERATING MANUAL



P/N 974124
10/04 Rev. A
ECO # 27882

 **Dynisco**

TABLE OF CONTENTS

	Content	Page	Icon
1.	General	3	
2.	Notes on safety	5	
3.	Technical data	6	
4.	Function	11	
5.	Transport/delivery	12	
6.	Assembly	13	
7.	Commissioning	15	
8.	Maintenance	17	
9.	Troubleshooting	19	



1. GENERAL

1.1	Important information	3
1.2	Copyright	3
1.3	Explanation of icons	4
1.4	Abbreviations	4
1.5	Correct use	4
1.6	User's obligations	4

1.1 IMPORTANT INFORMATION

This manual applies to the PT303 only. It must be kept near the equipment in a readily and immediately accessible location at all times.

The content of this manual must be read, understood and followed in all points by all relevant people. This applies in particular to the notes on safety. Following the safety instructions will help to prevent accidents, defects and malfunctions.

DYNISCO will not be held liable for any injury, loss or damage resulting from failure to follow the instructions in this manual.

If malfunctions occur in spite of having followed the operating instructions, please contact the **DYNISCO** customer service department (see chapter 8, Maintenance).

This applies in particular during the warranty period.

1.2 COPYRIGHT

Copyright law requires that this manual be used for in-house purposes only.

All reproduction, even partially and for in-house purposes, requires the approval of **DYNISCO**. This manual may not be forwarded to third parties.



1.3 EXPLANATION OF ICONS

The manual uses icons to indicate information pertaining to safety:

ATTENTION

Risk of destruction or damage to equipment, machines or installations



General danger to life or limb



Specific danger to life or limb



You **MUST** do this

The safety instructions are provided again in the individual chapters of the manual.

1.4 ABBREVIATIONS

The following abbreviations are used:

- OM** Operating manual
- f.s.** of full scale
- PT** pressure transmitter

1.5 CORRECT USE

The PT303 is designed for measuring pressure in explosive atmospheres (Class I, Division 1, Groups A, B, C & D) as part of a larger overall system. It contains an integrated signal amplifier. The PT303 pressure transmitter can be used in media temperatures up to 170°F. If the pressure transmitter is used in other applications, the safety and accident prevention regulations specific to that application must be followed.

1.6 USER'S OBLIGATIONS

The operator or owner of the larger overall system, e.g. a machine, is responsible for following the safety and accident prevention regulations that apply to the specific application.



2. NOTES ON SAFETY

The operator or owner of the larger overall system is responsible for following the safety and accident prevention regulations that apply to the specific application.

Mounting and electrical connection of the PT must be done by specialists with EMC training, following all applicable regulations, and in **pressureless, voltage-free** condition with the **machine switched off**.

The machine must be secured against being switched back on!

Ambient temperature for the electronics housing **max. +170°F**.

Higher temperatures can result in damage and malfunction. Do not install the pressure transmitter in places where this temperature is exceeded.

Explosion hazard!

Deviation of the supply voltage from the value given in the technical specifications, or false polarity, can damage the pressure transmitter and cause malfunctions that can pose a risk of explosion.

Operate with a power supply with the following specifications when employing the pressure 0 - 5 Vdcoutput:

Do not lay connecting cables in the direct vicinity of cables carrying higher voltage or used to switch inductive or capacitive loads.




3. TECHNICAL DATA

3.1	Ordering guides	6
3.1.1	Ordering guide for PT303	6
3.2	Ordering example	6
3.3	Safety related specifications	6
3.4	Performance characteristics	6
3.4.1	Accuracy	7
3.5	Wiring/Electrical Termination	7
3.6	Pressure ranges	8
3.6.1	Max. Overload	8
3.6.2	Natural frequency	8
3.7	Electrical Data	8
3.8	Weight	9
3.9	Dimensions	9


3.1 ORDERING GUIDES

The exact meanings of the letter/digit combinations are given in the corresponding sections of chapter 3.

3.1.1 ORDERING GUIDE FOR PT303

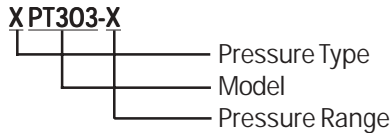

3.2 EXAMPLE FOR ORDERING

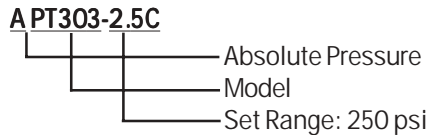

3.3 SAFETY RELATED SPECIFICATIONS

FM approvals Class I, Division 1 Groups A, B, C & D

3.4 PERFORMANCE CHARACTERISTICS

PT303-X

TECHNICAL DATA



3.4.1 ACCURACY


±0.25% of full scale (Including Linearity, hysteresis and repeatability)

3.5 WIRING/ELECTRICAL TERMINATION

The electrical termination of the PT303 is 72" of four conductor shielded cable, #22 AWG conductors, with 1/2-14 NPT conduit fitting.

Color	Function
Red	Signal +
Black	Signal -
White	Excitation +
Green	Excitation -

Fig. 3-1 Typical Wiring Diagram

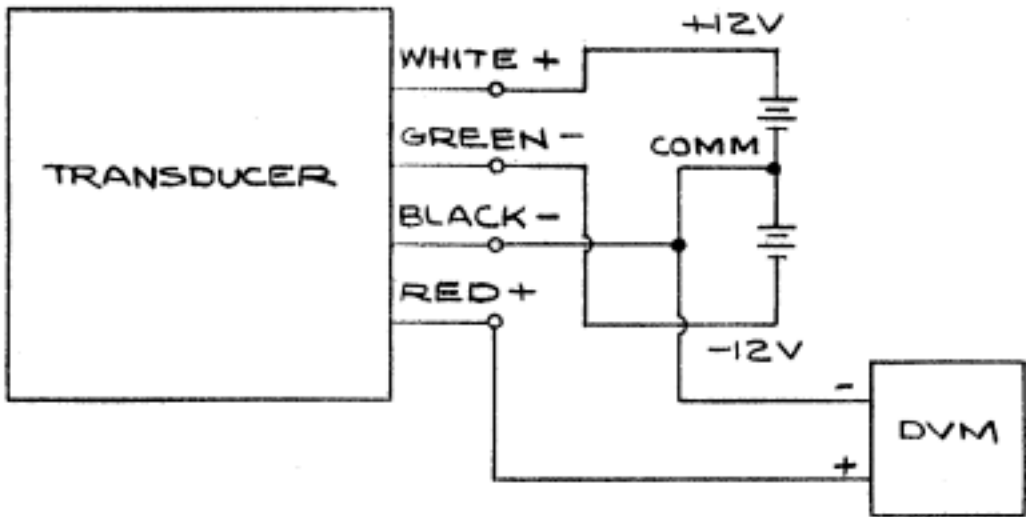



3.6 PRESSURE RANGES

Model number	Permitted pressure range in PSI
(A) PT303-15	0-15
(A) PT303-30	0-30
(A) PT303-50	0-50
(A) PT303-75	0-75
(A) PT303-1C	0-100
(A) PT303-1.1C	0-110
(A) PT303-1.75C	0-175
(A) PT303-2C	0-200
(A) PT303-2.5C	0-250
(A) PT303-3C	0-300
(A) PT303-4C	0-400
(A) PT303-5C	0-500
(A) PT303-7.5C	0 - 750
(A) PT303-1M	0-1,000
(A) PT303-1.5M	0-1,500
(A) PT303-2M	0-2,000
(A) PT303-2.5M	0-2,500
(A) PT303-3M	0-3,000
(A) PT303-5M	0-5,000
(A) PT303-7.5M	0-7,500
(A) PT303-10M	0-10,000

3.6.1 MAX. OVERLOAD (WITHOUT INFLUENCING OPERATING DATA)

PT303 2x rated pressure

3.6.2 FREQUENCY RESPONSE

>2000 Hz

3.7 ELECTRICAL DATA

Configuration	4-arm Wheatstone bridge strain gauge with int. amplifier
Output signal	4-wire 0-5 Vdc
Supply voltage	+/- 12 Vdc for FM approved explosion proof models




3.8 WEIGHT

~3.5 pounds

3.9 DIMENSIONS



Fig. 3-2 PT303 Mechanical Drawing

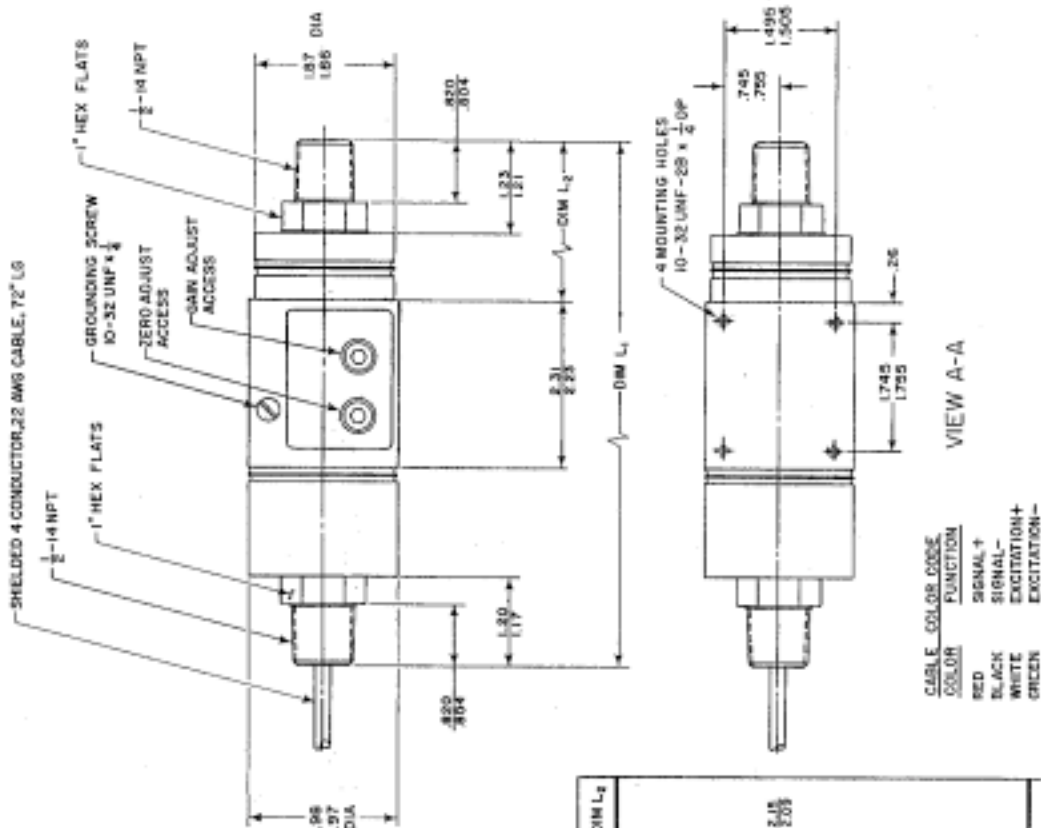

MODEL NO.	O.E. PT. NO.	DIM L ₁	DIM L ₂
PT303-5	300242-2		
PT303-50	300242-3		
PT303-50	300242-4		
PT303-75	300242-5		
PT303-75	300242-6		
PT303-110	2776290-3		
PT303-150	300242-7		
PT303-1750	2776290-2	2.08	2.15
PT303-20	2776290-2	2.08	2.15
PT303-250	2776290-11	2.08	2.15
PT303-30	300242-8		
PT303-40	300242-10		
PT303-40	300242-11		
PT303-50	300242-12		
PT303-750	300242-13		
PT303-1M	300242-14		
PT303-1.5M	300242-15		
PT303-2M	300242-16		
PT303-2.5M	300242-17		
PT303-3M	300242-18		
PT303-5M	300242-19		
PT303-7.5M	300242-20		
PT303-10M	300242-21		
APT303-32	2776290-6	1.83	2.88
APT303-20	2776290-7	1.75	2.88
APT303-30	300242-1		



4. FUNCTION

4.1	Construction	11
4.2	Description of Functions	11

4.1 CONSTRUCTION

The PT303 are General Electric standards.

The main advantages are:

- thermal stability
- resistance to aggressive media

4.2 DESCRIPTION OF FUNCTIONS

Through a closed, direct contact measurement system, the PT furnishes an electrical signal that is proportional to the pressure of the media.

The pressure is applied by the medium on the measuring diaphragm. The deflection of the measuring diaphragm changes the resistance of the strain gauge bonded to the measuring diaphragm. The strain gauge is a Wheatstone bridge.

Depending on the model, the integrated amplifier generates an electrical signal (Vdc) proportional to the pressure.



5. TRANSPORT / DELIVERY

5.1	Transport / packing / transport damage	12
5.2	Storage	12
5.3	Scope of delivery	12

ATTENTION ESD sensitive component. Electrostatic discharge may damage the PT. Take ESD precautions.

5.1 TRANSPORT/PACKING/TRANSPORT DAMAGE

- Do not let the PT be damaged by other items during transit.
- Use only the original packaging.
- Report transport damage to **DYNISCO** immediately in writing.

5.2 STORAGE

- Store the PT in original packaging only.
- Protect against dust and moisture.

5.3 SCOPE OF DELIVERY

- Pressure Transmitter
- Calibration sheet
- Operating manual with declaration of conformity



6. ASSEMBLY

6.1	Mounting the Pressure Transmitter	13
6.2	Electrical connection	13
6.3	Connection assignments	14



Ambient temperature for the electronics housing max. +170°F.

Higher temperatures can result in damage and malfunction.



Do not install the pressure transmitter in places where this temperature is exceeded.

6.1 MOUNTING THE PRESSURE TRANSMITTER



Mounting and electrical connection of the PT must be done by specialists with EMC training, following all applicable regulations, and in **pressureless, voltage-free, intrinsically safe** condition with the **machine switched off**.



The machine must be secured against being switched back on!

ATTENTION ESD sensitive component. Electrostatic discharge may damage the PT. Take ESD precautions.

ATTENTION Before mounting the PT, check the process connection carefully.

ATTENTION Before mounting the PT, ensure that the process connection is free from media.

ATTENTION To prevent the PT from sticking permanently in the process connection, coat the thread section of the transmitter with high temperature resistant grease or a suitable parting agent.

ATTENTION Always use a torque wrench when screwing the PT in and out. Do not apply the tool to the housing or housing / electrical connection!

- Screw the PT into the process connection and tighten.

6.2 ELECTRICAL CONNECTION



Mounting and electrical connection of the PT must be done by specialists with EMC training, following all applicable regulations, and in **pressureless, voltage-free**, condition with the **machine switched off**.

The machine must be secured against being switched back on!



Do not lay connecting cables in the direct vicinity of cables carrying higher voltage or used to switch inductive or capacitive loads.

ATTENTION ESD sensitive component. Electrostatic discharge may damage the PT. Take ESD precautions.

6.3 CONNECTION ASSIGNMENTS

Conduit / Leads

Red	Signal +
Black	Signal -
White	Excitation +
Green	Excitation -

7. COMMISSIONING

7.1	Supply voltage	15
7.2	Calibration	15
7.3	Zero adjustment	16
7.4	Operation	16

7.1 SUPPLY VOLTAGE

Please read the entire manual prior to installation and use. Maximum excitation is 28 Vdc. Rated excitation is +/- 12 Vdc. Recommended warmup is 15 minutes.

Explosion hazard!

Deviation of the supply voltage from the value given in the technical specifications, or false polarity, can damage the pressure transmitter and cause malfunctions that can pose a risk of explosion.


7.2 CALIBRATION

ATTENTION Calibrate in pressureless state and at room temperature. Other ambient temperatures will corrupt the signal. Use an adjustment screwdriver!

The adjustment is made at two potentiometer screws in the cover section of the electronic housing.

- Remove the cap screws from the potentiometers.

Fig. 7-1 Gain and Zero Access on Electronics Housing

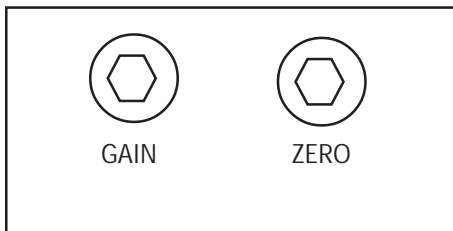

- Connect a meter or suitable instrument to the signal output to verify the settings.
- Adjust zero at potentiometer adjusting zero screw and verify on meter.



7.3 ZERO ADJUSTMENT

For PT303, adjust zero at operating temperature!

- Wait until a steady operating temperature is reached at the pressure sensor.
- Adjust zero at potentiometer adjusting zero screw and verify on the meter.
- Replace the cover screws on the potentiometers.

7.4 OPERATION

ATTENTION Operating temperature at the PT diaphragm **max. 170°F**. Higher temperatures will damage the PT.



Ambient temperature for the electronics housing **max. 170°F**. Higher temperatures can result in damage and malfunction.

Do not install the pressure transmitter in places where this temperature is exceeded.



8. MAINTENANCE

8.1	Maintenance	17
8.2	Repair/disposal	17
8.3	Warranty	18

8.1 MAINTENANCE



Mounting and electrical connection of the PT must be done by specialists with EMC training, following all applicable regulations, and in **pressureless, voltage-free** condition with the **machine switched off**.

The machine must be secured against being switched back on!



Burn hazard!

The PT can be very hot when removed.



Wear protective gloves!

ATTENTION ESD sensitive component. Electrostatic discharge may damage the PT. Take ESD precautions.

ATTENTION Always remove the PT before cleaning the machine with abrasives or steel wire brushes or suchlike.

ATTENTION Removing the transmitter if the medium is in solidified condition can damage the diaphragm of the PT.

ATTENTION Do not clean the screw-in section of the PT with hard objects. This will damage the PT!

ATTENTION Always use a torque wrench applied to the designated hexagon collar when screwing the PT in and out. Do not apply the tool to the housing or housing/electrical connection!

- Remove the PT.
- Carefully clean the PT/process connection of the transmitter with a soft cloth, while the medium is still malleable.

8.2 REPAIR/DISPOSAL

Please send defective PTs to your **DYNISCO** representative.

For addresses, see the back cover of the operating manual.



8.3 WARRANTY

This DYNISCO product is warranted under terms and conditions set forth in the DYNISCO web pages. Go to www.dynisco.com and click “warranty” at the bottom of any page for complete details.



9. TROUBLESHOOTING

Fault	Possible Cause	Resolution
No signal	Cable breakage or poor contact	Check cable and contact, or replace
	No supply voltage	Check supply voltage
Strong zero shift when screwing in	Process connection incorrectly produced (alignment error)	Check process connection with test bolt, rework if necessary
	Mounting torque too high	Adjust to recommended mounting torque
No signal change despite pressure rise	Plug forming in front of diaphragm	Check process connection
	Diaphragm damaged	Send pressure transmitter to DYNISCO for repair

DyniscoLLC
38 Forge Parkway
Franklin, MA 02038
USA

Tel: +1 508 541 9400
Fax: +1 508 541 9436
Email: InfoInst@dynisco.com

Dynisco Extrusion
1291 19th St Ln NW
Hickory, NC 28601

Tel: 828-326-9888
Fax: 828-326-8882
Email: InfoExtr@dynisco.com

Dynisco Polymer Test
Westgate II
730 Hemlock Road
Morgantown, PA 19543

Sales & Service:
Tel: 508-541-9400
Fax: 508-541-6206
Email: InfoPT@dynisco.com

Dynisco Europe GmbH
Wannenäckerstraße 24
74078 Heilbronn
Deutschland

Tel: +49 7131 2970
Fax: +49 7131 23260
Email: DyniscoEurope@dynisco.com

Dynisco Instruments S.a.r.l.
466, rue du Marché Rollay
94500 Champigny sur Marne
France

Tel: +33 1 4881 8459
Fax: +33 1 4881 8334
Email: DyniscoFrance@dynisco.com

Dynisco.s.r.l.
Via Adriatico, 2/2
20162 Milano
Italia

Tel: +39 02 661 01733
Fax: +39 02 661 02908
Email: Dyniscoltaly@dynisco.com

Dynisco UK Ltd.
Silver Birches Business Park
Aston Road, Bromsgrove
Worcestershire B60 3EU
Great Britain

Tel: +44 1527 577077
Fax: +44 1527 577070
Email: DyniscoUK@dynisco.com

Dynisco SPOL, S.R.O.
cp. 579
756 55 Dolni Becva
Czech Republic

Tel: +42 0571 647228
Fax: +42 0571 647224
Email: Dynisco_cz@ova.pvtnet.cz

Dynisco B.V.
Muziekplein 67
PO Box 666
NL-5400 AR Uden
The Netherlands

Tel: +31 413 250665
Fax: +31 413 260548
Email: Dynisco-BV@dynisco.com



Dynisco
Service

24 HOURS A DAY
7 DAYS A WEEK

www.dynisco.com

1-800-DYNISCO (US)
00-800-DYNISCO-0 (Europe)